



# Kayak HD

DIGITAL PRODUCTION SWITCHER

Release Notes Addendum  
Software Version 7.0.2.15

# Contacting Grass Valley

<b>International Support Centers</b>	<b>France 24 x 7</b>	+800 8080 2020 or +33 1 48 25 20 20	<b>United States/Canada 24 x 7</b>	+1 800 547 8949 or +1 530 478 4148
<b>Local Support Centers (available during normal business hours)</b>	<b>Asia</b>	<b>Hong Kong, Taiwan, Korea, Macau:</b> +852 2531 3058 <b>Indian Subcontinent:</b> +91 22 24933476 <b>Southeast Asia/Malaysia:</b> +603 7805 3884 <b>Southeast Asia/Singapore:</b> +65 6379 1313 <b>China:</b> +861 0660 159 450 <b>Japan:</b> +81 3 5484 6868		
		<b>Australia and New Zealand:</b> +61 1300 721 495	<b>Central/South America:</b> +55 11 5509 3443	
		<b>Middle East:</b> +971 4 299 64 40 <b>Near East and Africa:</b> +800 8080 2020 or +33 1 48 25 20 20		
	<b>Europe</b>	<b>Belarus, Russia, Tadzikistan, Ukraine, Uzbekistan:</b> +7 095 2580924 225 <b>Switzerland:</b> +41 1 487 80 02 <b>S. Europe/Italy-Roma:</b> +39 06 87 20 35 28 <b>-Milan:</b> +39 02 48 41 46 58 <b>S. Europe/Spain:</b> +34 91 512 03 50 <b>Benelux/Belgium:</b> +32 (0) 2 334 90 30 <b>Benelux/Netherlands:</b> +31 (0) 35 62 38 42 1 <b>N. Europe:</b> +45 45 96 88 70 <b>Germany, Austria, Eastern Europe:</b> +49 6150 104 444 <b>UK, Ireland, Israel:</b> +44 118 923 0499		

Copyright © Thomson, Inc. All rights reserved.  
This product may be covered by one or more U.S. and foreign patents.

## Grass Valley Web Site

The [www.grassvalley.com](http://www.grassvalley.com) web site offers the following:

**Online User Documentation** — Current versions of product catalogs, brochures, data sheets, ordering guides, planning guides, manuals, and release notes in .pdf format can be downloaded.

**FAQ Database** — Solutions to problems and troubleshooting efforts can be found by searching our Frequently Asked Questions (FAQ) database.

**Software Downloads** — Download software updates, drivers, and patches.



## END-OF-LIFE PRODUCT RECYCLING NOTICE

Grass Valley's innovation and excellence in product design also extends to the programs we've established to manage the recycling of our products. Grass Valley has developed a comprehensive end-of-life product take back program for recycle or disposal of end-of-life products. Our program meets the requirements of the European Union's WEEE Directive, the United States Environmental Protection Agency, and U.S. state and local agencies.

Grass Valley's end-of-life product take back program assures proper disposal by use of Best Available Technology. This program accepts any Grass Valley branded equipment. Upon request, a Certificate of Recycling or a Certificate of Destruction, depending on the ultimate disposition of the product, can be sent to the requester.

Grass Valley will be responsible for all costs associated with recycling and disposal, including freight. However, you are responsible for the removal of the equipment from your facility and packing the equipment to make it ready for pickup.

For further information on the Grass Valley product take back system please contact Grass Valley at + 800 80 80 20 20 or +33 1 48 25 20 20 from most other countries. In the U.S. and Canada please call 800-547-8949 or 530-478-4148, and ask to be connected to the EH&S Department. Additional information concerning the program can be found at: [www.thomsongrassvalley.com/environment](http://www.thomsongrassvalley.com/environment)



# Version **V702.15**

JUNE 2010

## *Release Notes Addendum*

### **Kayenne XL Package**

#### **Software Issues Corrected in Release Version V702.15**

<b>Area</b>	<b>Description</b>	<b>ID</b>
Kayak HD Frame	When running in SD video standard the key store freeze function does not work.	109796
Kayak HD Frame	LUM Keys 5/6 and ME50 LUM Keys distinguish from full M/E LUM Keys on identical Clip/Gain settings.	111255
Kayak HD Frame	Timeline recall with inhibit bgnd enabled on the half M/E causes the KHD frame to reboot	112714
Kayak HD Frame	AMP/LAN with Summit: On certain stress conditions, frame feedbacks can become corrupted, Kayenne XL panel can hang up.	113048
Kayak HD Frame	M/E-Couple / coupled fader gets out of sync after several fades.	112781
Kayenne XL Panel	Source button can lock when 'SHIFT coupled' mode is enabled.	113022
Kayenne XL Sidepanel	Input source selection list displays only one column / some sources not available for selection.	112801
Kayenne XL Sidepanel	Many clips on HDD slows down Transfer Menu / some functions do not work any more.	112833
Kayenne XL Sidepanel	Media Player Clips menu: The directory listbox cuts off long directory names.	112834
Kayenne XL Sidepanel	LAN machines with clips in sub-folders do not show thumbnails.	112803
RamRec	Ram Recorder transfer gets stuck when cable unplugged.	112624

## Software Issues Corrected in Release Version 7.0.2.12

Area	Description	ID
Kayenne XL Panel	Sometimes Kayenne XL panel locks up	112451

## Software Issues Corrected in Release Version 7.0.2.11

Area	Description	ID
Kayak HD Frame	Permanently enable access to 32 AMP LAN connections (no license needed any more).	110312
Kayenne XL Panel	Sometimes Kayenne XL panel does not connect to the Kayak HD mainframe.	111885
Kayenne XL Panel	Lost communication between mainframe and panel. Panel stays illuminated, but no action can be done.	111165

## Software Issues Corrected in Release Version 7.0.2

Area	Description	ID
Kayenne XL Panel	Intermittent dead Source Select Module after Power Up	105636
Kayenne XL Panel	Dutchview customer issue: The "Panel OnAir" is wrong in "Follow fader direction" Mode	102302
DPM	Canal+ customer issue: DPM Save recall loop: not moving at the loop point	84437
DPM	Canal+ customer issue: DPM Edit: the arrows should be inverted	84435

## Known Restrictions

Area	Description	ID
M/E	M/E couple does not support utility buses.	61954
E-Mem	E-MEM does not recall clips from media player. Workaround: It is possible to recall the clips from an external device by importing a Macro into the timeline. First program a Macro that loads a clip from an external device and test it to make sure it works. Second, create your timeline and import the contents of the Macro into the timeline. Currently you must use the Sidepanel for this workaround. Store the timeline, and the clip will be recalled in the effect.	62380
DPM	Performing a Factory Preset recalls DPM 0, but it should recall the system default values. Workaround: Store default values in DPM 0 on all M/E's available. Don't use DPM 0 for general effects.	62852
DPM	DPM auto run doesn't run the effect. It will only auto run if you manually rewind the effect. Workaround: Manually rewind the effect to autorun.	63368
USB Flash Drive	If a USB flash drive is detected on a USB port during startup the Kayak Panel remains black. Workaround: Remove the USB flash drive and reboot the system by turning the power off and then back on.	63621
DPM	When doing a DPM-Transition in TransPVW mode the opacity level (s) of included Keyer(s) are affected.	65060
Effects	Wipe-shapes using maximum H+V modulation are popping In/Out at the start/end of a transition.	65064
DPM	In S-Linear, path is still being calculated as curve	67528
Flash Disk	Description of erasing effects from Flash 3 disk is misleading.	67607
MatteFill/Glow	Combining Matte Fill and Glow on a key can cause Noise in image.	71270
Spektra Glow	Combining Matte Fill and Glow on a key can cause Noise in image. Adjust color difference to eliminate noise.	71270
Ram Rec	RAM video flashes when recording stills in SD. The flash is not recorded!	71646
Ram Rec	Cannot reset the RamRec without losing Stills and Clips in memory.	71736
Keyframe	Modify All KF's doesn't work with Define MEMO.	72798
Turbo	Turbo won't take cue commands in BVW mode.	77050
Ram Rec	RAM Recorder clips can't be played from E-MEM, unless a macro is created to play the clip and the macro is inserted in the effect.	77179
Keyframe	Montage mode is inaccurate when stamping on Keyframe	78609
E-Mem	Wrong "Auto Aux PVW" source after E-Mem Recall when M/E('s) is set to "Permanent DSK PVW".	81158
Config	When using "Audio follow Video" the half M/E can't be selected in "Config/E-Box/Audio-Audio Settings".	81689
UMD	When displaying a M/E "PGM-OUT" of any M/E on a connected UMD, the Keyer status disappears when selecting another M/E PGM-Out in PGM-Bus of the UMD-monitored M/E.	81982
E-Mem	A copied E-Mem register is empty if it is copied with the "Copy Config / Detailed" dialog on the side panel.	83170
Keyers	The factory default for Keyer and E-MEM modes is "DD", not "Default". Workaround: After performing a factory reset, always set the Keyer and E-MEM modes to the preferred settings in the menu Install/Ebox/Misc.	83572
DPM	Montage with slab effects does not function properly.	83592
DPM	Modify All Absolute not working correctly in Recursives.	83805
Oditics Protocol	Profile XP 1100 using Odetics Protocol. Neither Go To Timecode command from EMEM or from the Media Player menu will cue the Media Player.	85240
Router	Kayak router interface can not access all router inputs.	86544
Ram Rec	Loading a still mutes the user control of audio.	86566
Ram Rec	Stills are not recalled correctly to Channels 2,4,6 if they were previously in vid/key mode.	86596

<b>Area</b>	<b>Description</b>	<b>ID</b>
Ram Rec	Sometimes after doing a "Join Vid/Key" when the clip or still is loaded onto paired channels the video image is loaded into both channels. If you perform "Split Vid/Key" and then re-join them they will work correctly.	87110
Ram Rec	RamRec Audio has distortions on Panasonic Monitors (de-embedders).	87773
Ram Rec	Ram recorder does not record Audio in Record Edit mode.	88441
Ram Rec	In SD mode the Active Area is set to HD values.	93162
DPM	Copying from an iDPM effect to the eDPM, 3D locate values for the Global Channel don't copy.	96745
eDPM / iDPM	Copy eDPM effect to iDPM doesn't include 3D locate values for the Global channel.	96745
Environment File	Input names including space are not recalled after environment is loaded from .ini file	99007
Appli	An Appli name containing a special symbol (extended character) will cause a loss of data.	99008
Genlock	Install/Ebox/Timing: It's not possible to do a numerical input of the Genlock Phase.	102139
Kayenne XL Panel	Macro editing does not work for the Kayenne XL panel.	102149
Kayenne XL Sidepanel	On the harddisc in a saved application the directory EDPM Effects will not shown even though it exists.	102152
Kayenne XL Sidepanel	The Key5/6 busses can not be assigned to Tally Out bits. .	102154
Key Memory	Key Memory doesn't work for Key 5+6.	102186
Kayenne XL Panel	A USB keyboard doesn't work, even though it is detected.	102189
Kayenne XL Panel	With Selfkey the Fill bus shows no red tally if Matte Fill or Lin Key is selected.	102223
ME	When ME-H is copied to another ME, Keyer 5/6 and all MISC, which are not part of ME-H state, are copied.	104616