

Maestro



Master Control

Release Notes Addendum



SOFTWARE VERSION 1.1

071850701
July 31, 2006

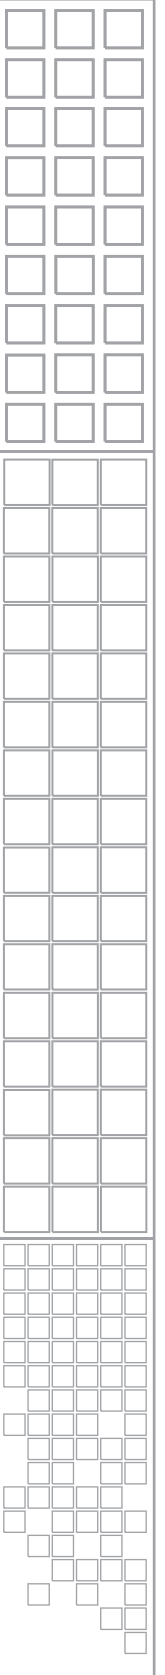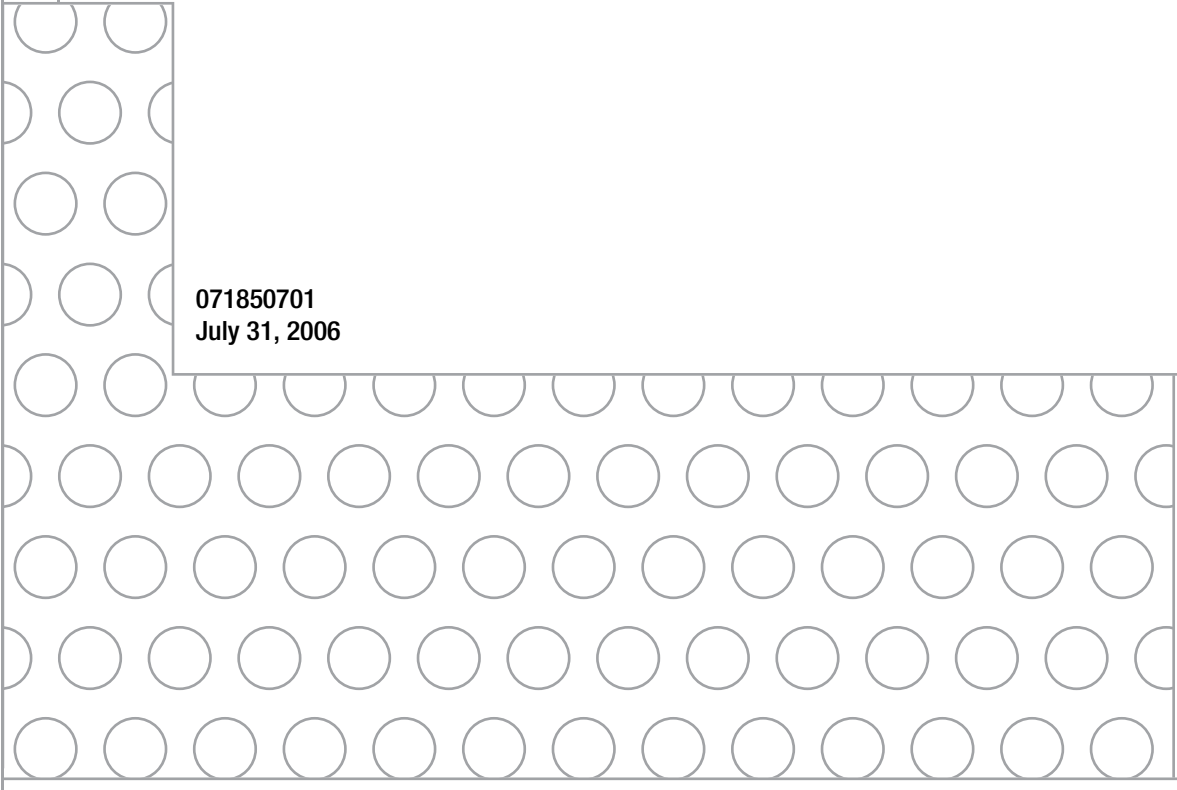

Contacting Grass Valley

Region	Voice	Fax	Address	Web Site
North America	(800) 547-8949 Support: 530-478-4148	Sales: (530) 478-3347 Support: (530) 478-3181	Grass Valley P.O. Box 599000 Nevada City, CA 95959-7900 USA	www.thomsongrassvalley.com
Pacific Operations	+852-2585-6688 Support: 852-2585-6579	+852-2802-2996		
U.K., Asia, Middle East	+44 1753 218 777	+44 1753 218 757		
France	+33 1 45 29 73 00			
Germany, Europe	+49 6150 104 782	+49 6150 104 223		

Grass Valley Web Site

The www.thomsongrassvalley.com web site offers the following:

Online User Documentation — Current versions of product catalogs, brochures, data sheets, ordering guides, planning guides, manuals, and release notes in .pdf format can be downloaded.

Copyright © Grass Valley, Inc. All rights reserved. All specifications subject to change without notice. This product may be covered by one or more U.S. and foreign patents.



END-OF-LIFE PRODUCT RECYCLING NOTICE

Grass Valley's innovation and excellence in product design also extends to the programs we've established to manage the recycling of our products. Grass Valley has developed a comprehensive end-of-life product take back program for recycle or disposal of end-of-life products. Our program meets the requirements of the European Union's WEEE Directive, the United States Environmental Protection Agency, and U.S. state and local agencies.

Grass Valley's end-of-life product take back program assures proper disposal by use of Best Available Technology. This program accepts any Grass Valley branded equipment. Upon request, a Certificate of Recycling or a Certificate of Destruction, depending on the ultimate disposition of the product, can be sent to the requester.

Grass Valley will be responsible for all costs associated with recycling and disposal, including freight. However, you are responsible for the removal of the equipment from your facility and packing the equipment to make it ready for pickup.



For further information on the Grass Valley product take back system please contact Grass Valley at + 800 80 80 20 20 or +33 1 48 25 20 20 from most other countries. In the U.S. and Canada please call 800-547-8949 or 530-478-4148, and ask to be connected to the EH&S Department. Additional information concerning the program can be found at: www.thomsongrassvalley.com/environment



Maestro Release Notes Addendum

Functions Not Presently Available

Area	Function
System	DVE option not available
System	Branding engine option not available
System	Output protection not available
System	Tally not available
System	VBI configuration not available - pass-through only
System	Black hold not available
System	Audio/Video breakaway is not available
System	Master control log file not available
Video	720P/60 and 720P/50 operation not available
Video	Multiplicative keying not available (keys are additive only)
Video	HSL key adjustment not available
Audio	Source parameter memory will not retain modifications since source was selected if power is cycled
Audio	Second set of eight audio channels (double-high rear panel option) not available
Audio	Dolby-E pass-through not available
Control panel	Non-synchronous source not indicated on control panel
Control panel	VGA display brightness memory not available
Control	GPI control not available
Control	ESLAN connection to Jupiter not available (connection is serial only)

Problems Corrected with Release 1.1

CR	Problem	Area
66759	Clean feed output does not fade to black. This has been corrected.	Video
67028	In the RCS Connection Table, Protocol column, if the mouse is used to open the drop-down menu the keyboard cannot be used to type in the entry. This has been corrected.	Configuration
68162	The Error LED on the frame Processor board is does not seem to operate consistently. This has been corrected.	Processor
68382	Control panel LCD button displays may be black following initialization. This can be cleared by making a new selection. This has been corrected.	Control panel
68485, 68435, 68672	Time required for channel delegation is inconsistent. This has been corrected.	System

Known Problems

CR	Problem	Area
66442	In the Network Description table, LAN IP Address field, when selecting the field for editing there is padding at the end that should not be there. "Delete" must be selected twice to remove the last digit.	Configuration
66802	Video inserts in GUI control panel sometimes go black. This can be fixed by maximizing and then minimizing the screens.	GUI
67888	If Encore switches router outputs feeding Maestro to sources unknown to Maestro, Maestro will not refresh those outputs properly.	Encore
68286	Changes made to the Input Set, compiled, and downloaded to the frame Processor are not reflected in the GUI Source Assign panel unless the GUI application is restarted.	GUI
69535	Text on GUI panel buttons is limited to approximately 6-8 characters because the text does not wrap to a second row. The exact number of characters that can be shown varies because the font used is variable width. Users should test input names and other text to determine if text will be truncated.	GUI
69897	Making any change to the "Folder" field in the Configuration box of the Deployment Control Center menu, including re-selecting "C:\Thomson," will delete all files in that directory. Do not attempt to change or re-select the default "C:\Thomson" folder.	Deployment Control Center