

# Kalypso


VIDEO PRODUCTION CENTER

## Release Notes Addendum



SOFTWARE VERSION 14.0.0

071072244  
DECEMBER 2006

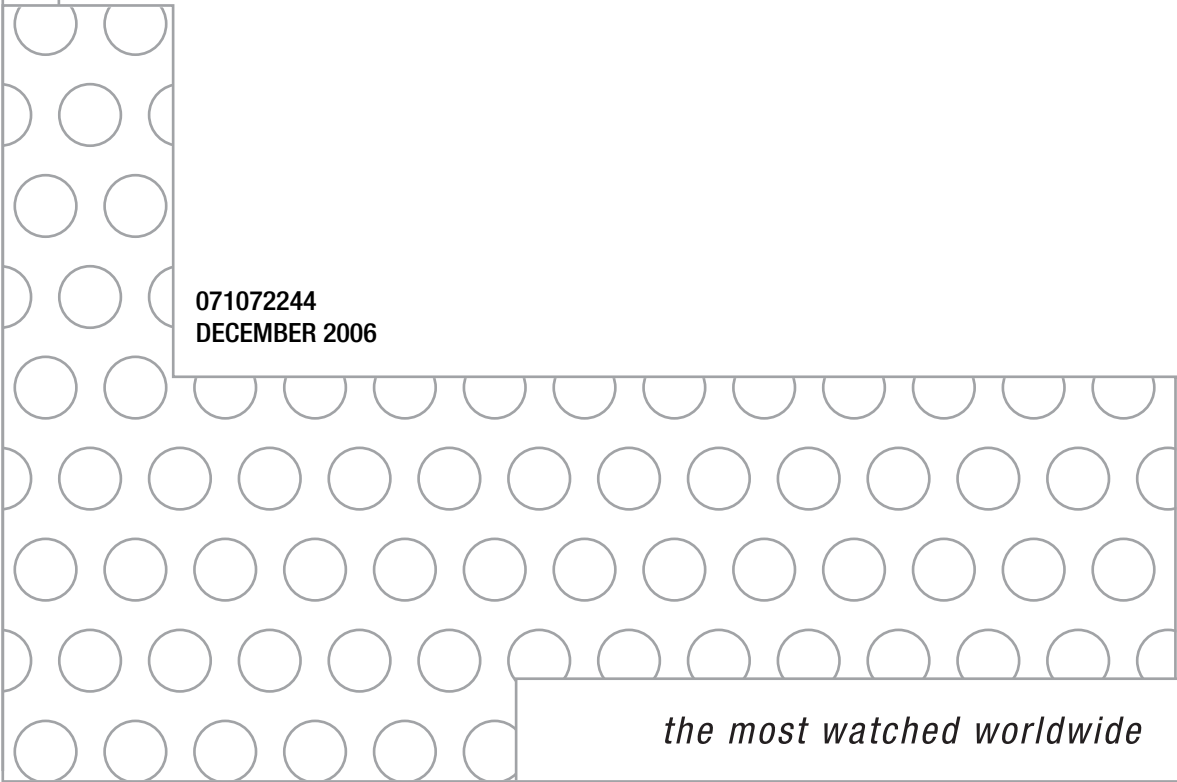

*the most watched worldwide*

# Contacting Grass Valley

Region	Voice	Fax	Address	Web Site
North America	(800) 547-8949 Support: 530-478-4148	Sales: (530) 478-3347 Support: (530) 478-3181	Grass Valley P.O. Box 599000 Nevada City, CA 95959-7900 USA	www.thomsongrassvalley.com
Pacific Operations	+852-2585-6688 Support: 852-2585-6579	+852-2802-2996		
U.K., Asia, Middle East	+44 1753 218 777	+44 1753 218 757		
France	+33 1 45 29 73 00			
Germany, Europe	+49 6150 104 782	+49 6150 104 223		

Copyright © Grass Valley. All rights reserved.

## Grass Valley Web Site

The [www.thomsongrassvalley.com](http://www.thomsongrassvalley.com) web site offers the following:

**Online User Documentation** — Current versions of product catalogs, brochures, data sheets, ordering guides, planning guides, manuals, and release notes in .pdf format can be downloaded.

**FAQ Database** — Solutions to problems and troubleshooting efforts can be found by searching our Frequently Asked Questions (FAQ) database.

**Software Downloads** — Software updates, drivers, and patches can be downloaded.

Version **14.0.0**

DECEMBER 2006

# *Kalypso Release Notes Addendum*

## **Software Issues Resolved in Version 14.0**

*Table 1. Resolved Software Issues*

<b>Area</b>	<b>Problem</b>	<b>ID</b>
Aux Outputs	Pairing engineering output 47 48 as Aux Pair causes menu application to crash.	62832
Aux Panel	Selecting "none" xpt on 1RU Sat Aux Panel kills frame.	70971
Chroma Key	Chroma Key Auto Setup is not functioning properly.	60313
E-MEM	Using Cut removes the next KF.	62784
Keyer	Util 1 & 2 filling Pst Pat Border swapped for K1 and K2.	58012, 58674
Machine Control	More than 255 characters in M Series directory names will cause Kalypso to crash.	63095
Macros	Macros created to load Still Store images that were recorded into any directory other than the Default Still Store directory may not load these Still Store images after system reboot.	63031
Macros	Macros created with software versions earlier than 12.0.0 that loaded Still Store images fail to load these images when run with version 12.0.0.	63788
Multi-Suite Mode	In Multi-Suite mode, cannot load Suite Preferences after changing suite.	63029
Still Store	Intermittently unable to perform a Still Store load more than once.	57300
Transform Engine Classic only	On Kalypso Classic systems, the Transform Engine Kurl Slits mode rectangular shape may change when modulation pattern/amplitude is applied.	22359
Transform Engine HD/Duo only	When lighting and Kurl/Slits are enabled together, video image is corrupted.	52481

# Known Software Problems

Table 1. Known Software Problems

Area	Problem	ID
AMP	K2 AMP machine does not respond if messages are less than 5 frames apart.	70541
AMP	Ethernat has priority of Serial commands for AMP protocol	70551
Bus Linking	Bus Linking the U1 and U2 buses as masters to the A and B buses as slaves will cause undesired results when simultaneously transitioning the Primary and Secondary partitions of a split M/E. Work around is to use the A and B buses as masters when linking Primary and Secondary partition background buses.	32099
Chroma Key	When Source Memory is on, if a keyer specifying a Chroma Key is selected, but a Chroma Keyer is not available for use, Source Memory for that source reverts to Fixed Linear Key. Later, if a Chroma Keyer becomes available, selecting that keyer source produces a Fixed Linear Key, not the desired Chroma Key.	31404
Chroma Key Classic only	When using Forced Mask in a Chroma Key, turning Mask Opacity down to zero does not eliminate the key.	40313
Chroma Key Classic only	Chroma Key Coring adjustment affects all Fill video.	40387
Copy Swap	Parts of a Copy operation that are not enabled in the destination of the copy may not be recognized by MOD operations. This is especially true when copying TE data to a keyer that doesn't currently have the TE enabled. Work around: The first time you Copy and MOD, the TE will be enabled, but that data may not be transferred. If you Copy MOD a second time, the rest data will be transferred.	52305
E-MEM	E-MEM/Source Memory doesn't always properly handle Transform Engine parameters for Front/Back switching if the switch does not occur on a keyframe and the Front/Back parameters are significantly different from each other. Work around is to add a keyframe at the switch point.	11468
E-MEM	When running an effect in reverse with several pauses in the timeline, the effect will stop at the first pause and will not continue running in reverse on subsequent button presses.	19095
E-MEM	The Kalypso system does not recognize the flip/flop of buses at the end of a transition as a modified parameter. This means the Modify button cannot be used to edit an effect with these automatically selected sources, and it also affects setting up Effects Dissolves. Work around is to perform the transition and then select the ending sources manually, or simply select the two sources manually without performing the transition. Once sources have been manually selected, Modify and Effects Dissolves will work.	28014
E-MEM	When Master E-MEM has multiple levels out of sync (for example, enabling one Master E-MEM level, partially running it, disabling that level and enabling another level, and then running it), and the Master E-MEM is parked at or past the end of the effect, pressing the Run button snaps all levels to the Master's current time and then the run stops because the effect is at the end. A second press of the Run button is then required to run the effect. A work around is to rewind effects manually before running them. (If the levels are already parked at their beginning, the rewind won't disturb that state.)	29836
E-MEM	When at the last keyframe of an effect with Stop Next KF on, pressing Run fails to update the Work Buffer with the first keyframe of the effect. Rewind works correctly.	44885
E-MEM	In 300 Mode the offset register indicator '^A'b does not always display on the E-MEM RT Panel display when it should. The timeline display correctly shows the offset register condition.	51108
E-MEM	Recall/Auto Run of effect sometimes does not run.	52161
E-MEM	Problem with EMEM recall of clips in multiple directories AMP Serial.	74126
E-MEM Recall	Machine Control panel allows loading of stills and clips of a miss-matched format. Work-around: Enable "Auto Run" in the Master E-MEM section. The double hit recall work-around only works if you don't recall to AIR and remember to do it each time before you run your effect.	67904
E-MEM Box Mask	Box Mask control values for effects built with version 7.6.2 and earlier software are incompatible with later releases. E-MEMs that use Box mask built with these earlier software versions will need to be rebuilt on systems running a later software version.	42556
File Operations	Cancelling a load user profile operation does not revert to a pre-load state.	60696
GPI Output	If a negative value is entered for GPI output Duration, it wraps to max value. This is a problem with all UINT32 parameters from the keypad popup.	26248
Hold	Holding a crosspoint during E-MEM recalls still updates source memory.	11871

Table 1. Known Software Problems - (continued)

Area	Problem	ID
Key Priority	Keyframes and Effects Dissolves do not work on Key Priority modes. The mode is always recalled as a cut at the end of a transition.	22064
Keypad Data Entry	Existing keypad values are not cleared when negative values are entered on the Main panel unless the negative key is pressed last. For example, if 5 is the starting value, pressing - 1 results in a -15 value. Pressing 1 - gives the desired -1 value.	29886
M/E Re-entry	If an effect is learned to re-enter M/E 1 into M/E 2 or 3, then another effect is learned to re-enter M/E 2 or 3 into M/E 1 in a different register, the re-entries do not swap as they should.	23395
Machine Control	Cannot roll synchronously multiple external device channels using Gang control.	48820
Machine Control	AMP Serial Protocol - If the program clip and preset clip belong to different folders, the RT Panel sometimes displays the wrong clip list.	51506
Macros	When using a macro to control several Transform Engine (TE) parameters, all the parameter changes may not be executed when that macro is played back. The TE requires processing time to calculate changes, particularly those for source space. Work around is add 2 fields of delay to the macro between each TE parameter change.	37984
Macros	Macros run from the Main panel do not perform Engineering Setup parameter changes. Work around is to run Macros with Engineering Setup changes from the Macro Menu (being sure to be logged in as the EIC).	38385
Macros	A Pre-Attach macro can cause button release to be intermittently missed. Work arounds include: If you only have a Pre-Attach macro and the button function, create a macro that has the button function and Post-Attach it to the button. Then attach the Pre-Attach macro functionality as a Replace Attach to the button. Alternatively, you can build a single macro with the entire functionality (including the macro and button function) and attach it as a Replace Attach macro. If you have a Pre-Attach macro, button functionality and a Post Attach macro, insert timing delays until the macro works reliably.	40391
Mask	For v12.0.0 the E-MEM default Mask setting is OFF. The default for versions before v12.0.0 was ON, because the Keyer Mask menu did not exist on Kalypso systems. E-MEMs created with earlier versions of software that employ Keyer Mask will need to be loaded and re-saved with the Mask setting turned ON for proper operation.	63851
Menu	The Menu application occasionally takes more than a minute to shut down. Though it appears to have shut down, it hasn't completed and a new Menu application cannot be started until the old one has finished shutting down. Work around is to bring up Task Manager and End the old Menu task so that you can start a new instance of the Menu.	42739
Mod All Absolute	The Mod All Absolute feature, available in the Timeline Menu, applies Transform Engine X and Y position parameter changes to all keyframes in an effect even if only one position parameter was changed.	29115
NetCentral	On failure of one or more fans in the frame, Net Central III reports an informational message that The system cooling-fans resumed normal operation.	35757
Panel	Time display often shows frames rather than seconds for Keyframe Durations.	10730
PGM	Phase shift on PGM when PST is cut Key 1 w DPM	51775
Pixelator	Pixelator appears masked and only operational on Keyers 1 and 3.	50884
Pixelator (HD Only)	Pixelator controls do not work on Background and Utility buses on Kalypso HD systems running in 720p mode. Pixelator controls do operate on key buses, however. Work around is to put the source on a key bus clipped to full frame and pixelate the key.	54104
Preset Black	If a Preset Black transition is performed half way (black is being output), recalling an E-MEM with Effects Dissolve will show the transition on the output and then return to black.	12512
Preset Bus	At times, re-entry sources shift one line compared to direct sources.	53678
Remote Aux Panel	Bus Linking: using a remote aux panel to control an aux bus (which is linked to an M/E) bus is not reliable.	72197
Resource Sharing	Default Keyframe stays with the physical M/E.	34251
Router Interface	Router sources do not show up on Menu or panel if router source is via a Tie line.	60080
Serial Tally	Extended character set corrupts tally name message. No character above 0x81 supported.	33844
ShotBox	Resetting the Shot Box causes Master E-MEM to recall register 00. Work round is to make sure all levels are disabled on Master E-MEM before resetting the Shot Box.	50938
Source Memory	When key mode changes during source change, the keyer stays in freeze mode.	17424

Table 1. Known Software Problems - (continued)

Area	Problem	ID
Source Override	Source Override not working against source selection from menu.	35185
Split Mode	Keyer flash when changing between Split and PCF/Normal mode with E-MEMS.	68764
Still Store	Playing back a Still Store animation clip on multiple outputs causes the dropping of frames across all outputs. Playback will appear to be double speed or faster. There is no work around for this problem, except to not load clips onto more than one output.	21148
Still Store	Resetting the Still Store posts an inaccurate NO FRAME COM message on the menu. Communication with the Video Processor frame remains intact during Still Store reset. Only communication with the Still Store is interrupted during Still Store reset.	22290
Still Store	Still Store directory changes are not saved/recalled via E-MEM.	57570
Still Store	In Still Store, loop count cannot be changed while an animation is in progress. Loop count can be changed when the animation has stopped.	61206
Still Store	Marking Thumbnails, while an animation is in progress, interrupts clip playback.	61208
Still Store	In Still Store, changing to a new directory with a lot of clips causes the thumbnail menu to flash till a complete list is received.	61627
Still Store	Changing video rate does not unload stillstore cache.	61371
Still Store	When running in 1080i mode, the status returned during stillstore operations (such as a load) is not always correct.	61372
Still Store	Rapidly recalling stills using E-MEMs, Macros or manually can lock up the still store.	61628
Still Store	Cache Unload does not work intermittently.	61629
Still Store	Next button stops advancing clip/still list. Prev works ok.	61704
Still Store	Loading a still into one output can unload another output.	61966
Still Store	After turning off a Video Key pair, loading a still into the channel that was Key unloads the still in the channel that was Fill.	62307
Still Store	Doing Unlock/Uncache with outputs containing stills causes subsequent loading errors. One work around is to make sure no images are loaded on any output before performing the Unlock/Uncache operation. Loading and then unloading a faulty Still Store output restores normal operation.	63709
Still Store	Performing a Still Store animation and a Still Store save/load operation simultaneously makes the video not play smoothly.	29993, 34672
Still Store HD/Duo only	In SD Mode only, under some conditions Still Store playback can be slightly offset from its record.	41907
Still Store HD/Duo only	Still Store input vertically out of time in SD mode.	56164
Still Store HD/Duo only	Sometimes stills unload from paired outputs when changing directory.	63479
Strobe	In Live SF Mode, when Strobe is turned on with Freeze at 100% the picture freezes.	58891
Transform Engine	TE center of rotation is offset when rotating Z 180 deg	53322
Transform Engine	Timing shift on screen when selecting a re-entry with aTE or Fill Freeze enabled.	53960
Transform Engine	When a key signal is passed through a Transform Engine, for some angles and for certain size the video becomes blurry.	54858
Transform Engine Classic 16:9	On Kalypso Classic systems, 16 x 9 Page Turn offset does not allow the page turn effect to complete.	30558
Transform Engine HD/Duo only	Defocusing an image causes a vertical line of non-focused pixels on the left edge of the image. Work around is to crop the image.	52299
Transform Engine HD/Duo only	Some combinations of Transform Engine Lighting with the Kurl. Ripple mode create a moiré pattern in the lighting.	52482
Transform Engine HD/Duo Only	On some systems horizontal lines flash across Transform Engine.	51561
Wipe	Wipe scaling problem. Wipes appear on screen after the transition has started and complete before the transition panel has finished its transition.	11641